

EAA

427758



TANZANIA BUREAU OF STANDARDS CERTIFICATE OF ROADWORTHINESS



EAA Company Limited

No.: TR-2009-026-002Date of Issue: 2020/09/10Date of Appraisal: 2020/09/09

We hereby certify that the undermentioned motor vehicle was inspected by the EAA Company Limited and found to conform to the requirements of

TANZANIA STANDARDS TZS 698:2012

Make	<u>TOYOTA</u>	Model	<u>UA-NCP60</u>
Type of Vehicle			<u>Sedan</u>
Engine Capacity(c.c.rating)			<u>1,290 CC</u>
Year of First Registration			<u>2003/07</u>
Chassis Number			<u>NCP60-0109827</u>
Engine Number or Model		<u>2NZ</u>	<u>2804837</u>
Inspected Mileage(Odometer Reading)		<u>6,826#</u>	<u>km</u>
Inspected Date			<u>2020/09/09</u>

Remarks: We hereby certify that this motor vehicle does not exceed the radiation threshold level.

Note 1: No responsibility can be taken for alteration made to vehicle after this inspection.

Note 2: No responsibility can be assumed by this institute for any disputes, reparations, etc. caused by transaction involving the certified used motor vehicle as abovementioned.

EAA Company Limited

Nagoya



Director of
Inspection Dept

Inspection fee US\$150,00



NO TR-2009-026-002

This certificate is issued on the understanding that it does not relieve the seller from this contractual obligation.

THIS CERTIFICATE IS VALID FOR A PERIOD OF THREE(3) MONTHS FROM THE DATE OF ISSUE



EAA COMPANY LIMITED / Vehicle Roadworthiness Inspection Report

S/No. **TR-2009-026-002**

【Vehicle Details】

Chassis No: **NCP60-0109827** Model: **UA-NCP60** Engine Model: **2NZ**
 Maker: **TOYOTA** 1st Registration Year: **2003/07** Engine No: **2804837**
 Model Name: _____ Manufacture Year: **2003** Weight: **1020** Kg
 Engine Capacity: **1290** cc Type of Vehicle: **Sedan** FF Axis Weight: **630** Kg
 Body Color: **Silver** Mileage(Paper): **106,700** Km FR Axis Weight: _____ Kg
 Fuel Type: **GASOLINE** Odometer: **6,826#** km RF Axis Weight: _____ Kg
 RR Axis Weight: **390** Kg

【Inspection Details】

Location: **Kobe** Inspector: **Hayato Miyake**

【Test Drive】

Abnormal at Acceleration ☒ **Pass/Fail**
 Abnormal at Brake Test ☒

【Exhaust】

CO **0.08** % ☒
 HC **15** ppm ☒
 DS _____ %/m-1 ☒

【Headlights】

Luminance R **270** x100cd ☒
 L **290** x100cd ☒

【Side Slip】

IN / OUT **1.6** mm ☒

【Exhaust proximity noise】
 Average _____ dB(A) ☒

Attachment R _____ cm ☒
 (Height) L _____ cm ☒
 Optical Axis R _____ cm ☒
 (Under) L _____ cm ☒
 Optical Axis R _____ cm ☒
 (RL) L _____ cm ☒

【Speedometer】

Difference **0.0** km/h ☒
 Run-out **0** km/h ☒

【Radiation Dose】

☒

【Brake System】

FL **200** kg FR **180** kg
 ML _____ kg MR _____ kg
 RL **140** kg RR **120** kg
 PL **120** kg PR **110** kg

Sum main brake(Weight+55kg) **1075** x0.5= **538**
 Sum parking brake(Weight+55kg) **1075** x0.2= **215**
 Sum R wheel brake(axis weight) **390** x0.1= **39**
 Pull:Front(axis Weight+55kg) **685** x0.08= **55**
 Pull:Rear(axis Weight) **390** x0.08= **32**

Sum Main brake= **640** ☒
 Sum parking brake= **230** ☒
 Sum R wheel bake= **260** ☒
 Diff b/w R&L axis= **20** ☒
 Diff b/w R&L axis= **20** ☒

【Engine】

Engine ☒
 Fan belt ☒
 Battery ☒
 Master Cylinder ☒
 Caburetor ☒
 Fuel Pipes ☒
 Injection Pump ☒
 Wiring Haeness ☒
 Generator ☒
 Cooling Syatem ☒
 Manifolds ☒
 Lubrication System ☒
 CFC ☒

Result

【Equipment】

Tool ☒
 Jack ☒

Result

【Accessory】


A/C ☒
 Audio ☒
 Navigation ☒
 Alloy Wheel ☒

AT/MT: **AT**

【Underbody】

Wheel Bearing ☒
 Springs ☒
 Shock Absorbers ☒
 Suspension Fixing ☒
 Torque Rod ☒
 Gear Box ☒
 Steering Rod/Arm ☒
 Wheel Cylinder ☒
 Brake Rod/Cable ☒
 Breake Hose/Pipe ☒
 Front axle ☒
 Drive Shaft ☒
 Propeller Shaft ☒
 Axle Housing ☒
 Differential ☒
 Tyre Size ☒
 Tyre Condition ☒
 Tyre ETC ☒

Result

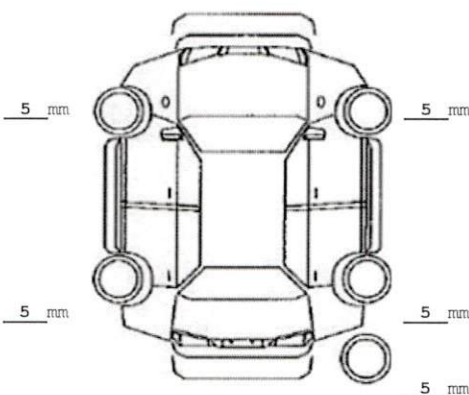

【Interior】

Steering Wheel ☒
 Power Steering ☒
 Horn ☒
 Gauges ☒
 Climate Control ☒
 Door ☒
 Windows ☒
 Wipers ☒
 Mirrors(Back & Sides) ☒
 Shift Lever ☒
 Safety Belts ☒
 Brake Pedal ☒
 Brake Booster ☒
 Clutch Pedal ☒
 Clutch Function ☒

Result

【Lights】

Head lamp ☒
 Indicator ☒
 Rear ☒
 Brake ☒
 ETC ☒

Result

【ETC】

Exhaust System ☒
 Air Suspension ☒
 Air Brake ☒
 Fuel Tank ☒

Result

【Damage】

Exterior ☒
 Interior ☒
 Underbody ☒

Result

F=Repair A=Scratch U=Dent R=Rust CR=Crack D=Damage

【Result】

Pass ☒
 Fail ☒

Inspector Signature **Hayato Miyake**

Inspection Date **2020-09-04**

【Reinspection】

Pass ☒
 Fail ☒

Inspector Signature **Hayato Miyake**

Inspection Date2 **2020-09-09**

【Fail Parts】

- ①Wipers : Arm is rusted
 ②F Door : This is rusted